



Hella: KIA SPORTAGE - ERROR CODE P2015 AND POOR ENGINE PERFORMANCE

1.7-litre diesel, 2010 - 05.2012

Error code P2015 and poor engine performance or loss of power



Important safety note: Technical information and practical tips have been compiled by HELLA in order to provide professional support to vehicle workshops in their day-to-day work. The information provided on this website is intended for use by suitably qualified personnel only.

ENGINE CONTROL LAMP LIGHTS UP / POOR ENGINE PERFORMANCE

The above-mentioned vehicles may experience a sudden loss of power. The engine control lamp lights up. Error code P2015 (intake manifold flaps/flap control for intake manifold) is stored in the control unit where appropriate.

In order to remedy this, all system-relevant components, the battery and the vehicle electrical system voltage should be checked. Furthermore, the error memories are to be read out/deleted. If all this does not lead to the desired success, a defective intake manifold actuator may be the cause of the problem. This is then to be replaced with a modified variant (283202A410).

Reprinting, distribution, reproduction, exploitation in any form or disclosure of the contents of this document, even in part, is prohibited without our express, written approval; indication of the document source is also required. The schematic illustrations, pictures and descriptions serve only for the purposes of explanation and representation of the instructions and cannot be used as a basis for installation or assembly work. All rights reserved.